



Parc de la Porte Nord-Rue Christophe Colomb  
62700 Bruay la Buisnière  
contact@crepim.fr http://www.crepim.fr  
Tél: 03-21-61-64-00 Fax : 03 21 61 64 01

### Test report NF EN 13823

**Test report n°** REE 5E 1039/22/181 A  
**Date** 15/07/14  
**Manager** Skander KHELIFI  
**Your order** 19381  
**Date of order** 20/06/14  
**Page** 1 on 4

**Adressé à**  
**Company** CENTEXBEL  
**Nome** Jo Wynendaele  
**Address** Technologiepark  
**Postcode** B-9052 **City** ZWIJNAARDE  
**Country** Belge

**Test standard :** NF EN 13823:2013: Reaction to fire tests for building products.  
**Building products excluding floorings exposed to the thermal attack by a single burning item.**

**Accredited COFRAC test :** COFRAC accreditation attests competence of the laboratories for the only tests covered by the accreditation

#### Product

**Name :** Rol tapijt  
**Description :** Decorative Wall covering  
**Density :** /  
**Surfacic mass :** /  
**Thickness :** 5 mm  
**Remarks :** /  
**Size :** 1500 x 1000 x 5 mm and 1500 x 500 x 5 mm  
**Conditionning :** 23 ± 2 °C, 50 ± 5 % HR  
**Reception date :** 25/06/14  
**Substrate and fixing method :** Glued with a OVALIT ULTRA 200g/m<sup>2</sup> on 13mm thick plasterbord  
**Manufacturer :** /

*The results are valid only for the fire-test-exposure conditions described in this procedure and for the specimens assessed.*

#### Results

**Test date :** 11/07/14 **Reception date :** 25/06/14

	Average of test
FIGRA <sub>0,2MJ</sub> (W/s)	478
FIGRA <sub>0,4MJ</sub> (W/s)	478
SMOGRA (m <sup>2</sup> /s <sup>2</sup> )	24,3
THR <sub>600s</sub> (MJ)	10,6
TSP <sub>600s</sub> (m <sup>2</sup> )	60,9

**Observations :** /



Parc de la Porte Nord-Rue Christophe Colomb  
62700 Bruay la Buisnière  
contact@crepin.fr http://www.crepim.fr  
Tél: 03-21-61-64-00 Fax: 03 21 61 64 01

**Test Report NF EN 13823**

Test report N° **REE 5E 1039/22/181 A**  
Page **2 on 4**

**Test results**

	Test 1	Test 2	Test 3
Thickness (mm)	5	Test not performed in Orientative tests	
Density (g/cm <sup>3</sup> )	/		
Mass per m <sup>2</sup> (g/cm <sup>2</sup> )	/		
FIGRA <sub>0,2MJ</sub> (W/s)	478		
FIGRA <sub>0,4MJ</sub> (W/s)	478		
SMOGRA (m <sup>2</sup> /s <sup>2</sup> )	24,3		
THR <sub>600s</sub> (MJ)	10,6		
TSP <sub>600s</sub> (m <sup>2</sup> )	60,9		

Flame spread to the edge	No	Test not performed in Orientative tests	
Flamming particles/drops <= 10s	No		
Flamming particles/drops > 10s	No		

Surface flashes	No	Test not performed in Orientative tests	
Falling specimen parts	No		
Fixing of backing board failed	No		
Distorsion/collapse of specimen	No		
Smoke leak	No		

Observations:






Parc de la Porte Nord-Rue Christophe Colomb  
62700 Bruay la Buisnière  
contact@crepim.fr http://www.crepim.fr  
Tél: 03-21-61-64-00 Fax : 03 21 61 64 01

**Test Report NF EN 13823**

Test report N° REE 5E 1039/22/181 A  
Page 3 on

Graphics

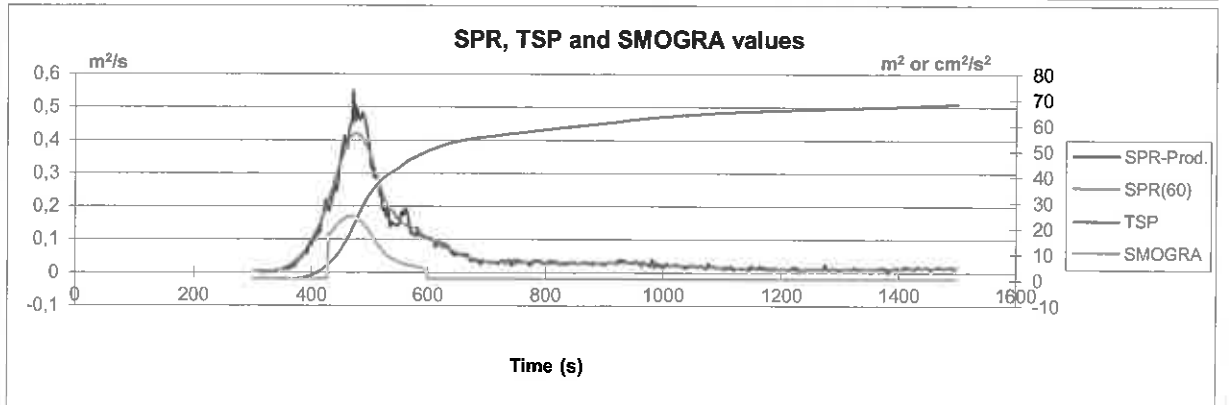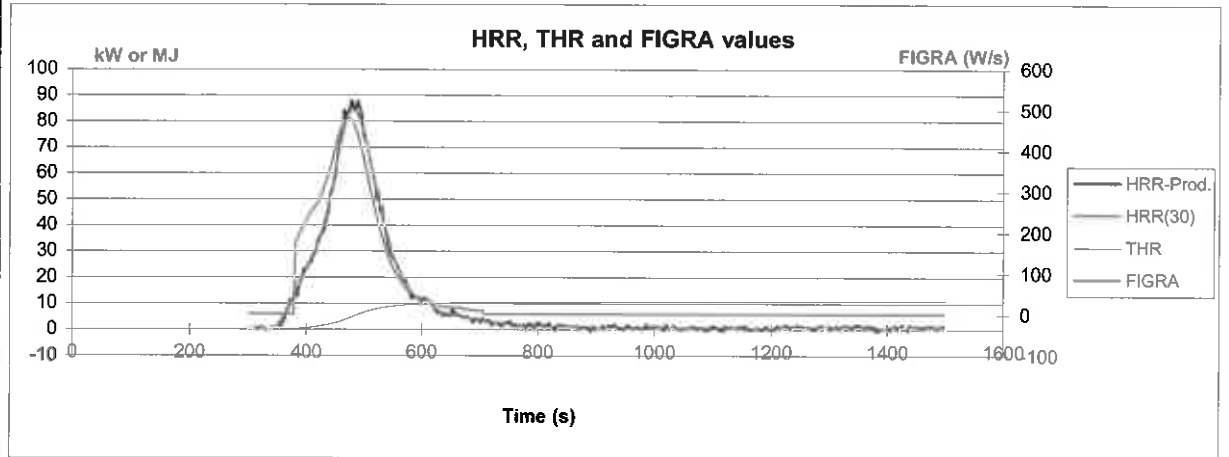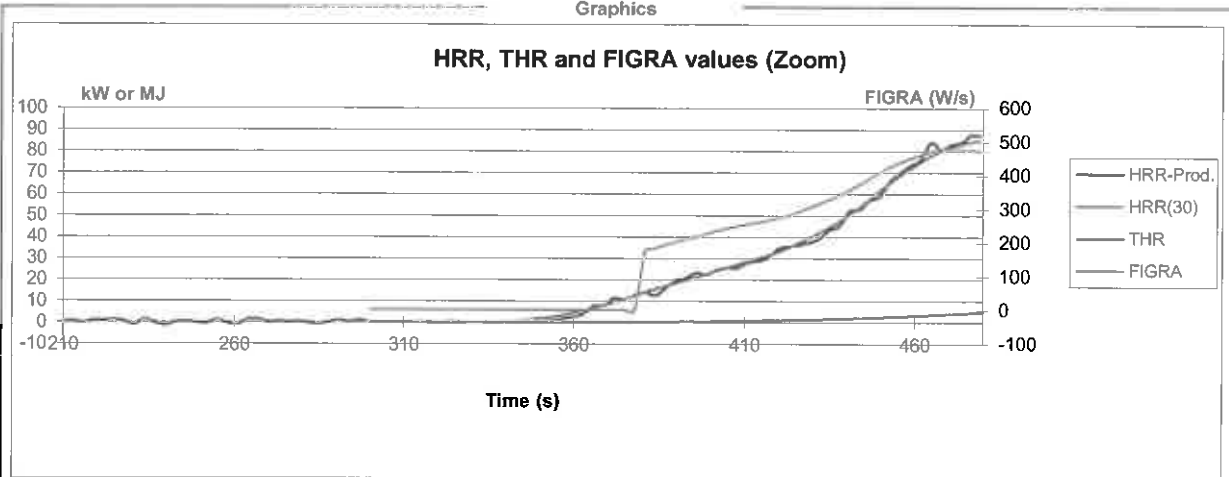

La reproduction de ce rapport d'essai n'est autorisée que sous sa forme intégrale. - Le rapport d'essai ne concerne que l'objet soumis à l'essai. - Pour déclarer, au nom, la conformité à la spécification, il n'a pas été tenu explicitement compte de l'incertitude associée au résultat.



Parc de la Porte Nord-Rue Christophe Colomb  
62700 Bruay la Buisnière  
contact@crepin.fr http://www.crepim.fr  
Tél: 03-21-61-64-00 Fax : 03 21 61 64 01

### Test Report NF EN 13823

Test report N° REE 5E 1039/22/181 A  
Page 4 on 4

Photos



C. LASSALLE Test Officer	P.O. P. GOBERT <i>[Signature]</i>
S. KHELIFI Technical Manager	<i>[Signature]</i>